







#### **Fuse Informations**

What are fuses?? They are protectors that prevent damage to electronic and electrical equipment. Fuses allow electric current to pass through them until the amount of current goes over the fuses rating. At the time, the fuse Blows and stop the flow of electric current. Fuses are rated in in amperes, the unit of measure for electric current.

Fast-ACTING / SLOW BLOW. Fast Acting fuses react quickly to current overloads. Slow Blow fuses are less sensitive to start-up surge and protect against long-term overlands

Fuse is a Saftey devices components. Always replace a blown fuse with the same type replace fast acting with fast acting, slow blow with slow blow. Slow Blow fuse are less sensitve to start-up the protection against long-term overloads.

Thera are four basic types of fuse: Slow-Blow/ Time LAG - Dual Element slow blow fuses / Fast-acting / Very fast Acting fuses.

A major type of slow blow fuse is the dual element fuse. This fuse consists of a short circuit strip and a soldered joint, spring connection. During overloads conditions, the soldered joints gets hot enough to melt and the spring shears the junction loose. Under short circuits conduitions the short circuit elements opersates to open the circuit. All dual-Elements fuses are considered to be slow blow, but not all slow blow fuses are dual elements.

Slow-blow fuses are ideal for circuits with a transient surge or power inrush. There circuits include: motors, transformers, incandescant lamps and capacitive loads. This inrush can be 20 times the normal current level. When using fast-acting, single elements type fuses, it is neccessary to rate fuse at 150% to 300% of thre circuits full load curent. With this rating rule inrush may cause nuisance openings.

Slow Blow fuses allow close rating of the fuse without nuisance opening. Typically rate the slow-blow fuses from 125% to 150° of the circuits full load process.

Fast-Acting fuses have no intentional built in slow-blow and are used in circuits without transient inrush Amp.

Very fast-acting fuses often have silver links. Because of the fuses current limiting ability, there fuses are frequently used to protect semiconductor circuits.

The current carrying capacity of a fuse: The nominal value upon which all performance characteristics of a fuse are based.

( Overcurrent) A condition which exits on a electrical circuit when the normals current is exceeded.

Overcurrents take on two separate characteristics - overloads and short circuits.

(Overload) Can be classified as an overcurrent which exceeds the normal full load current of a circuit. Also characteristics of this type of overcurrent is that it does not leave the normal current carrying path of the circuit. That is it flows from the source, through the conductors, through the load, back through the conductors, to the source again.

(Voltage Rating) For general circuit protection, the voltage rating on the fuse should be equal to, or greater than the circuit voltage of the circuit in which the fuse is applied. Exceeding the voltage rating of a fuse impairs ist ability to clear an overload or short circuit safely. Fuse can be used at any voltage below the fuse voltage rating; a 250V fuse can be used in 125V circuits.

EDCON has carefull the right to change specifications on any and all items shown on the webside or any supplements without prior notice providing the performance or appearance will not change the function of the items.

EDCON has carefull prepared the webside specifications contained herein. These specifications are for reference only, any inaccuracies may be due to typographical errors or changes made after the publications on our webside.

Cross Reference charts BUSSMANN / LITTLEFUSE / TELFUSE / BEL FUSE

Testing standards and equipment utilized for UL, CSA, METI, and IEC ... etc. Approvals (Specificy fuse type desired.

EDCON Components are guaranteed to be free form defects in material and workmanship for a reasonable period of time after delivery. Our öiability shall be limited to replacement to defective material only. Either seller or manufacturer shall be liable for any injury, loss or damage, direct or consequential, rising out of the use of or the inability to use the products for his intended use, user assumes all risk and liability whatsoever in connection therewith.

# SMT CERAMIC FUSE TIME LAG

Part No.: **R14001-0A400** 

Customer:

DRW:	Jason	CHKD	Jules	MATL:	Wu	DATE	06.06.2007
APPD:	Join			FINISH	Shieh	Sheet	1 from 3









### **Technical Specifications**

**Operating Temperature:** 

Shock:

Vibration:

Salt Spray:

**Insulation Resistance:** 

**Resistance to Solder Heat:** 

**Thermal Shock:** 

**Interrrupting Ratings:** 

Materials:

Body:

**Terminations:** 

Packaging:

. -55°C to +125°C

MIL-STD-202, Method 213, Test Condition 1

(100G's peak for 6 milliseconds

MIL-STD-202, Method 213, Test Condition 1

0.06 inch, total excursion

MIL-STD-202, Method 101, Test Condition B

(48hrs)

MIL-STD-202, Method 101, Test Condition A (After Openeing) 10.000 Ohms minimum MIL-STD-202, Method 210, Test Condition F

(20sec, at 260°C)

MIL-STD-202, Method 107, Test Condition B

(-65°C to +125°C)

50 amperes or 10 x rated currentm whichever

is greater at 125V AC/DC

Ceramic

Silver Plated Brass Caps


1000PCS in 7inces dia. White color reel, or 5000PCS in 13 inches dia white color reel,

12mm wide tape, per EIA Standard 481.

Rated Current	1,25 ln 2		In	10 ln	
Nateu Current	MIN		MAX	MIN	MAX
400mA	1hr		120sec	1ms	10ms

Serie	Ampere Rating (In)	Voltage Rating (V)	Nominal Resistance Cold Ohms	Voltage Drop (mV) MAX.	Nominal Melting I <sup>2</sup> t A <sup>2</sup> sec
R14001	400mA	125V	0,235	650	0,0472

## **Mechanical Dimension**

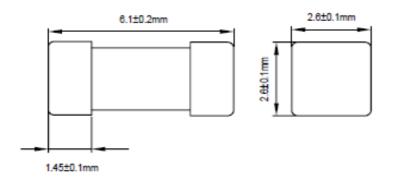

SMT CERAMIC FUSE TIME	:
LAG	

Part No.: R14001-0A400

Customer:

DRW:	Jason	CHKD	Jules	MATL:	Wu	DATE	06.06.2007
APPD:	Join			FINISH	Shieh	Sheet	2 from 3











#### **Approvals**

cac	(5)	<b>(</b>	DVE	P	€	KEMA	
	YES		YES				
(H)	[V@I]	PSE					
YES							_

#### **LEAD SOLDER CURVE**

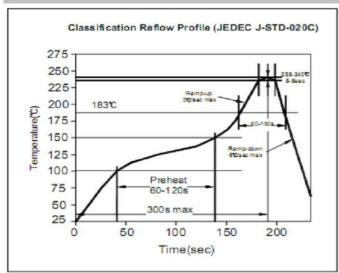

#### **LEAD FREE SOLDER CURVE**

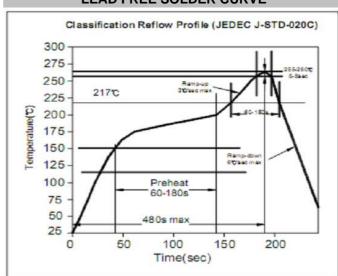

#### **Ordering Information**

Serie	Range	Specification	ROHS	Packing	
			_		
R14001	0A400	N	R	TR1	

	I	<b>D D O L I O</b>	I = - 4
<b>0A400</b> = 0,4A	<b>N</b> = No extra	R= ROHS	TR1=
<b>0A400</b> = 0,4A	Specification	Conform	Tape/Reel
		N= NON	1000PCS
		ROHS	TR5=
			Tape/Reel
			5000PCS
			BU1= Bulk-
			Ware

SMT CERAMIC FUSE TIME
LAG

Part No.: **R14001-0A400** 

Customer:

DDW.	looon	CHIND	luloo	MANTI.	۱۸/	DATE	06.06.2007
DRW:	Jason	CHKD	Jules	MATL:	Wu	DATE	06.06.2007
APPD:	Join			FINISH	Shieh	Sheet	3 from 3